

Measuring Magnetic Fields Using the Precision Fluxmeter F2



The Precision Fluxmeter F2 enables you to measure the magnetic values flux Φ , flux density B, field strength H and polarization J. A coil made for your specific purpose is connected to the fluxmeter as a probe.

This device is suitable for sophisticated measurements in the R&D department, automatic process control, quality control, and quality conformance inspection. Due to the built-in calibrator, long term accuracy is obtained.

Some examples of applications are

- measurement of flux density inside the air gap of magnet systems
- checking the polarization of magnets
- stray field measurements
- measurements of magnetic fields next to super conductors.

Several steps have been taken in order to minimize drift effects. The connecting plug of each probe is equipped with a memory chip, in which the relevant data of the probe are stored. By this, faulty measurements caused by improper parameter entries are impossible. Moreover, flux densities or field strengths can be directly displayed and conversion is not required.

Even the standard model of this fluxmeter has a digital interface which makes it possible to control the unit remotely. A tolerance test function and a digital peak value indicator are also built in. All required accessories such as probes, reference magnets etc. can be ordered with your fluxmeter.

The advantages of a fluxmeter compared to field meters using hall probes are:

- that in principle there is a linearity between intensity of magnetic field and output signal
- a wide range of operating temperature permitted for measuring coil
- the possibility of measuring flux inside iron parts and magnetic potentials

Edition March 2004 Page 1 of 5



Special Features

- low drift
- low thermo voltage probe connector plug
- built-in calibrator
- automatic probe recognition
- unit of measurement can be selected (flux, flux density, field strength, etc.)
- simple way of operation
- lit graphical display, easy to watch
- robust cabinet, can be mounted into 19" rack
- virtually all interfaces available
- built-in go/no-go test; user can set valves

- auto test when switched on
- pos. and neg. digital peak value indicator
- fast analog peak value indicator (most Gaußmeters cannot measure the sine pulse generated by a magnetizer)
- software update can be done via interface by using a standard PC
- 2nd input socket at the back panel of the cabinet
- frequency range 0..30 kHz
- All inputs and outputs decoupled galvanically

Technical Data

construction low drift integrator followed by a 19 bit analog digital converter

measuring ranges +/- 1mVs +/- 10mVs +/- 100mVs +/- 1Vs

range selection automatically or manually accuracy 0.5% after self calibration

accuracy 0.5% after self calibration noise suppression 50 / 60 Hz line power sample rate 16 conversions per second

calibrator section internal reference of voltage and time

drift $<\pm 1\mu Vs/min$

input resistance $1.2k\Omega \pm 0.1\%$ $10.2k\Omega \pm 0.1\%$

input terminals low thermovoltage miniconnectors at the front and back side of cabinet;

banana plugs at the back side

display graphical LCD 125mm x 35 mm², 4 digits of reading displayed, green lit,

contrast can be set via menu, bargraph

Analog Output I

function continuous output of readings

output voltage +/-10Vinner resistance 100Ω decoupled galvanically

Analog Output II

function output of peak value, reference

voltage, reference frequency

output voltage 0V - 10V inner resistance 100Ω update rate 62.5 ms decoupled galvanically

Edition March 2004 Page 2 of 5



Serial Interface

type RS 232C function SCPI (Standard Commands for Pro-

connector 9-pole DB-9 plug grammable Instruments) or

baud rate 300 - 9600 Baud printermode

handshake None, DTR/DSR, XON/XOFF memory 512 readings

Digital Outputs

number 4 number

functions low / high /go / run functions reset / hold or drift lock (can

Digital Inputs

log. level to be set in menu be set in menu) / 2 x spare

supply voltage DC 24V (externally fed) log. level to be set in menu

output current max. 100mA short circuit proof supply voltage 5-34V external / internal

technique M / P switching input resistance type. 2.2 KΩ

standard IEC1131 (24VDC) standard IEC1131 (24VDC)

Peak Value Measurement

analog analog peak hold circuits store even

short peaks. The positive and negative value is displayed. Maximum delay until output of value to analog output

is 62.5 ms (as option)

digital max. displayed reading is stored,

time slot pattern 62.5 ms (standard)

Software functions

Compensation of drift

Enable the external control of all fluxmeter functions

Digital smoothing of reading

Conversion of units

• Self calibration

• Bargraph

• Tolerance test

• Percent reading


Storage of probe parameter

• Manual range control, auto ranging

Edition March 2004 Page 3 of 5



Display Example

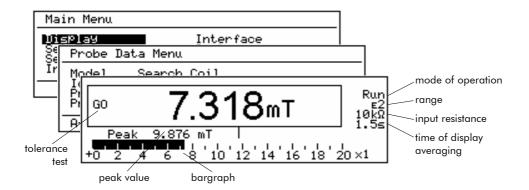

Scope of Delivery

- Fluxmeter
- · Operation manual
- Test report

 Floppy disk containing demo program (WIN version)

Options

- Opt. 001 USB interface
- Opt. 002 IEEE-488 (GPIB) interface
- Opt. 003 insulated parallel BCD output
- Opt. 004 external tolerance display
- Opt. 010 additional operation manual
- Opt. 999 warranty 2 years

Deliverable Accessories

- Search coils
- Helmholtz coils
- Potential coils
- Reference magnets
- Probe plug equipped with a 2 pole shielded cable, 2m long, for connection of self made coils to the fluxmeter. Built-in memory chip.
- Switch box for the connection of up to 5 probes to the fluxmeter. Power supply and control via single cable to fluxmeter.
- Coaxial cable 2m, BNC plugs at both ends
- Connecting cable for RS-232 interface, 2.5m long, 9 pole plugs at both ends
- Adaptor 9 pole plug to 25 pole socket
- Mounting kit for assembly of fluxmeter into 19" rack

Edition March 2004 Page 4 of 5

Product Information Precision Fluxmeter F2



Dimensions 125mm x 260mm x 260mm (H x W x D)

4.9" x 10.24" x 10.25" (H x W x D)

Weight 3.2 Kg (7 lb.) not including packing and accessories

Power Supply 100-130V / 210-250V internal voltage selection

Power Line Frequency 50-60 Hz
Power Consumption max. 25VA

Warranty 12 months standard (24 months with Option 999)

Further information? Please contact us:

MAGSYS magnet systeme GmbH

Rohwedderstr. 7 D-44369 Dortmund

Germany

Phone: +49 (0) 231 177 88-0 Fax: +49 (0) 231 177 88-22 e-mail: sales@magsys.de web: www.magsys.de MAGSYS magnet systems, LLC

2401 Beech Street, Suite D Valparaiso, IN 46383-6106

USA

Phone: +1 219-548-2202 Fax: +1 209-391-5637 e-mail: JMurphy@magsys.org web: www.magsys.de

AGATE PRECISION ENGINEERING

Block 3015A Ubi Road 1 #01-03/04 Kampong Ubi Ind. Est Singapore 408705

Singapore

Phone: +65 6748 8669 Fax: +65 6748 9619 e-mail: magsys@singnet.com.sg

web: www.magsys.de

TECHNICOME.com

WWW.technicome.com

Rue Edouard Branky

TA de Pissaloup Trappes Cedex France

RBP 102 - 78191 Trappes Fax: (0)1 30 69 15 01

Tél: (0)1 30 69 15 00 - Fax: (0)1 30 69 15 01

Edition March 2004 Page 5 of 5